

Sup 4/02

# Work Order ID 65985

Tuesday, February 01, 2011 7:08:31 AM



Page 1

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Item Name: Mid Tube Assembly

Stop



Start Date: 2/1/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 2/4/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

*[Signature]*

Date:

*1-01-11*

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D3391	Rev H

100

0.00



Skidtubes

Skidtubes

Skidtubes

Memo

0.00

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J", do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

*[Large handwritten signature]*

11-2-1

BB

11/02/11

# Work Order ID 65985

Tuesday, February 01, 2011 7:08:31 AM



Page 2

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 2/1/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 2/4/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

11-Open .375" holes to .438" \*\*\*do not open fwd saddle holes\*\*\*

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

15- Locating from two fwd wearplate holes drillol remaining 6 wearplte holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

DP

11-2-1

NA

NA

NA

NA

DP 11-2-1

**Work Order ID 65985**

Tuesday, February 01, 2011 7:08:31 AM

Page 3

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Start Date: 2/1/2011 Start Qty: 1.00

Required Date: 2/4/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

110



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

8 11/02/01

Memo

0.00

(70)

120



HandFinish

Hand Finishing

Chemical Conversion Coat per QS1005 4.1

0.00

Memo

0.00

1 8 2/1/02/01

130



QC

Quality Control

QC3- Inspect Part Finish

0.00

Memo

0.00

DP

11-2-1



# Work Order ID 65985

Tuesday, February 01, 2011 7:08:31 AM



Page 4

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 2/1/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 2/4/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

140

0.00



Skidtubes

Skidtubes

Memo

0.00

1-Open float bag holes as per dwg  
2-C'sink float bag holes as per dwg  
3- Prepare tube for welding  
4-Bond web in place as per Dwg D3391 & QSI 015.  
Adhere for 12 hours)  
A/R Sikaflex exp: 11-9-30  
batch#: M11604

1 0 BE 11/01/01

150

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

1 0 BE 11/02/02

160

0.00



Skidtubes

Skidtubes

Memo

0.00

1-Weld crossbolt spacer as per dwg D3391 & QSI 004  
2-grind weld flush

1 0 BE 11/02/02

**Work Order ID 65985**

Tuesday, February 01, 2011 7:08:31 AM

Page 5

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Setup Start

Stop

Start Date: 2/1/2011 Start Qty: 1.00

Required Date: 2/4/2011 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

Stop

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

170

QC10- Inspect visual per QSI004- ground welds

0.00



QC

Memo

0.00

Quality Control

8/11/2012

180

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

8/11/2012

(H)

185

Pressure Wash per QSI005 4.3

0.00



HandFinish

Memo

0.00

Hand Finishing

AND REALODINE AS PER PAR09-043

1 BR-11-02-3

# Work Order ID 65985

Tuesday, February 01, 2011 7:08:31 AM

Page 6

Item ID: D3391-023

Accept

Setup Start

Revision ID:

Stop

Item Name: Mid Tube Assembly

Start Date: 2/1/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 2/4/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID Tool # Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

190

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

Powdercoat

M 115981.

0.00

Powder Coating

Memo

START TIME: 10:45  
OVEN TEMPERATURE: 320°  
FINISH TIME: 11:15

1

BR 11-02-3

200

QC3- Inspect Part Finish

0.00

QC

Memo

0.00

Quality Control

11102103

1

# Work Order ID 65985

Tuesday, February 01, 2011 7:08:31 AM

Page 7

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Start Date: 2/1/2011 Start Qty: 1.00

Required Date: 2/4/2011 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

QC: Date: SPC (Y/N): Date:

Run Start

Stop

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

210

0.00



Skidtubes

Skidtubes

Memo

1- insert D3391-021 into D3391-23

0.00

2- insert T-pins into first and third fwd saddle holes

3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364

4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos

5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove DT9415

6- deburr, re-alodine and blow out chips

7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

220

0.00



QC

QC5- Inspect part completeness to step on W/O

Memo

0.00

Quality Control

N/A  
PER CUST. REQUEST.



# Work Order ID 65985

Tuesday, February 01, 2011 7:08:31 AM



Page 8

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 2/1/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 2/4/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan:

Date:

Tooling:

Date:

Stop



QC:

Date:

SPC (Y/N):

Date:

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

230

0.00

⇒ M 11/02/03



HandFinishing

0.00

HandFinish

Memo

Hand Finishing

Install Inserts as per Dwg

240

0.00

8/01/03



QC5- Inspect part completeness to step on W/O

0.00

QC

Memo

Quality Control

250

0.00



Identify as per dwg & Stock Location:

0.00

Packaging

Memo

Packaging

SP

03564-3

B66000

11/02/03

W/O: 65985		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
11/02/03	230	install => (1x) D3564-5 / B65058 (wear plate) (1x) D3566-5 / B64789 (Gasket)	JH	11/02/03	1 1		S 11/02/03	
11/02/03	230	wiht => (12x) AN3C-4A / M116075 (bolts) (12x) NAS1149 CO 332R / M116025 (washers)	JH	11/02/03	12 12		S 11/02/03	

Part No: D3391-023 PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

**Work Order ID 65985**

Tuesday, February 01, 2011 7:08:31 AM

Page 9

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Start Date: 2/1/2011 Start Qty: 1.00

Required Date: 2/4/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

260

QC21- Final Inspection - Work Order Release

0.00

QC

Memo

0.00

Quality Control

11/02/04

MF

11-02-04

# Picklist Print

Tuesday, February 01, 2011 7:08:28 AM

Page 1

Work Order ID: 65985

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly



Start Date: 2/1/2011

Required Date: 2/4/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A: 05.10.2011 New Issue! KJ/EC:1  
 IPP B: 106.02.1011 ECN773 dwg rev.D EC:1  
 IPP C: 07.03.20 rev F dwg EC  
 IPP D: 07.03.28 re-format EC  
 IPP E: 07.10.31 ecn 1053P EC  
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC  
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC  
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC  
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP  
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-100

Manufactured

No

100

Each

116.0000

1

1



Skidtube Extrusion

Location

Loc Qty

Loc Code

LG

116

37065

33

50251

83

D3391-021

Manufactured

No

100

Each

0.0000

1

1



Fwd Tube Assembly

D3389-1

Manufactured

No

140

Each

3.0000

1

1



Web

Location

Loc Qty

Loc Code

LG

3

63343


1

64877

2

1365989

①

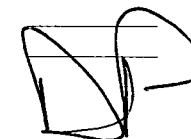

11-2-1

BE 11/02/01

# Picklist Print

Tuesday, February 01, 2011 7:08:28 AM

Page 2

Work Order ID: 65985

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 2/1/2011

Required Date: 2/4/2011

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No

160

Each

51.0000

5

5



Spacer

## Location

## Loc Qty

## Loc Code

LG

51

56802

14

57656

12

63321

5

64620

20

210

Each

31.0000

2

2

D3591-1 Manufactured No



Bushing

## Location

## Loc Qty

## Loc Code

ST072

31

47121

2

57350

29

230

Each

807.0000

20

20

ALS4-1032-130 Purchased No



Insert

## Location

## Loc Qty

## Loc Code

PKG11

480

114723

480

ST281

192

116049

192

ST282

96

110511

10

115911

86

ST381

39

114654

39

BE 1/02/02  
B 66025 (x5)

11/02/03 PTO => 1  
~~Page~~

Tuesday, February 01, 2011 7:08:29 AM

Shop Packet Print


Page 2

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY

SUBJECT TO AMENDMENT

WITHOUT NOTICE  
WORK ORDER

NO. 45985 *pl 45985*

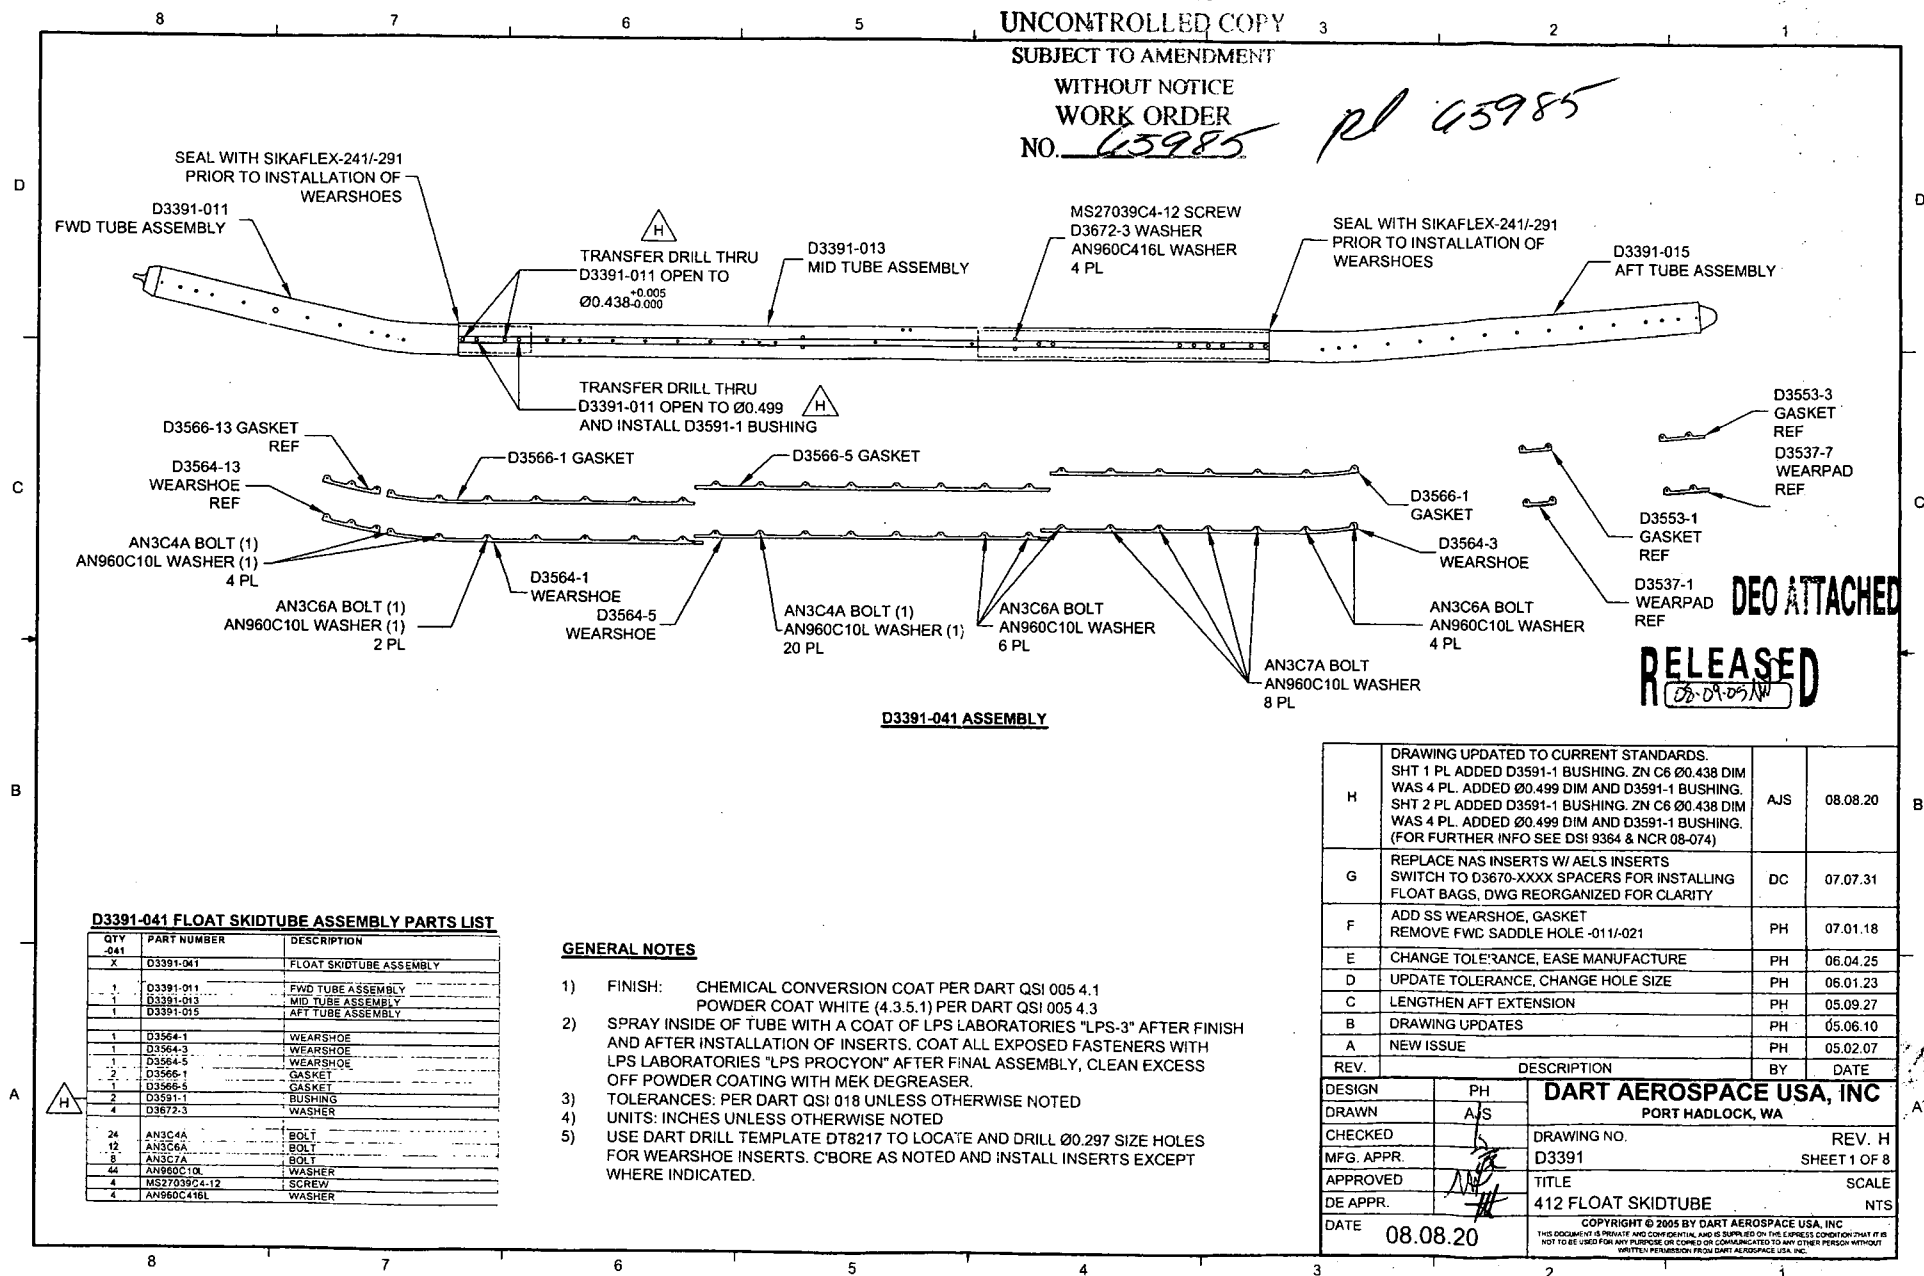

**D3391-041 ASSEMBLY**

**D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**


 
QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-5	WEARSHOE
1	D3564-13	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DEO ATTACHED

RELEASED  
*02-09-05 NW*

H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL. ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL. ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

u10 65985

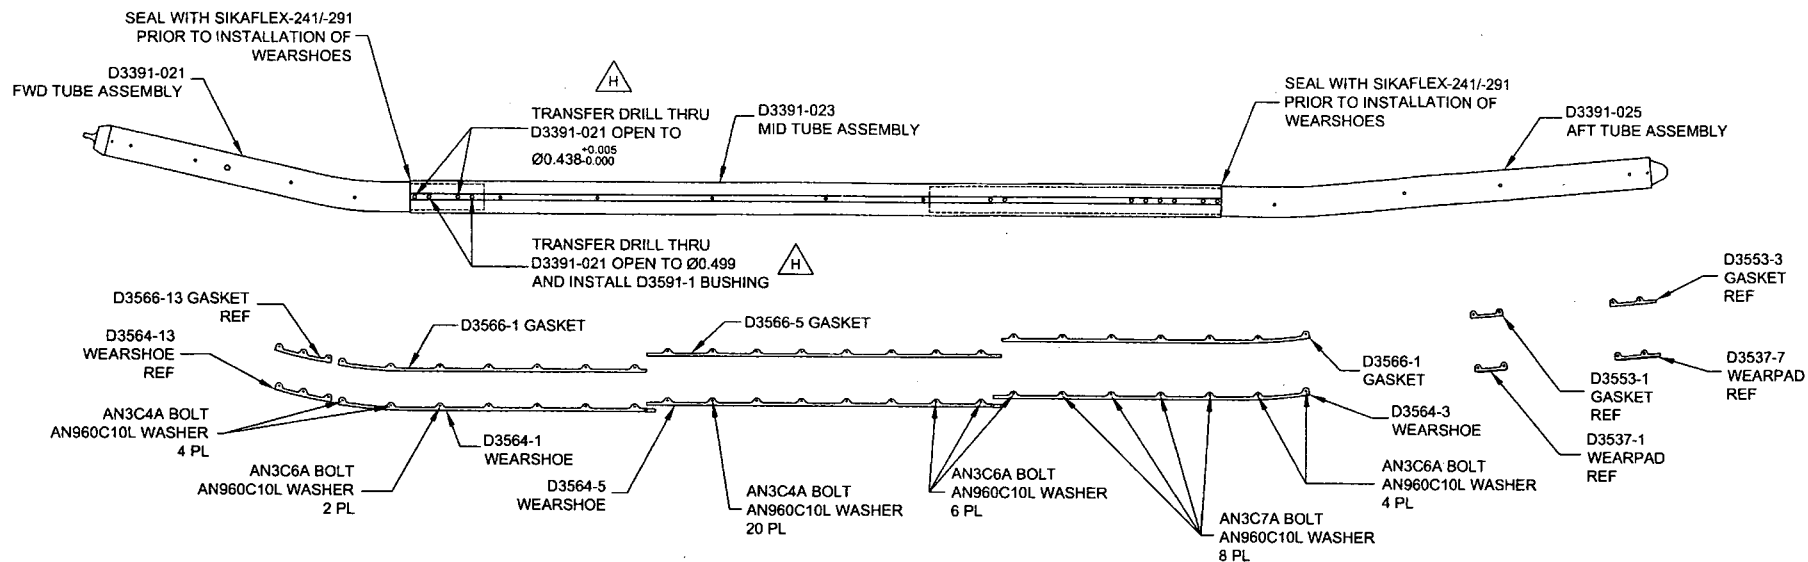

**D3391-043 ASSEMBLY**

**D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER

**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DEO ATTACHED

RELEASED  
08-09-25/11

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	




W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


**NOTE:** Date & initial all entries

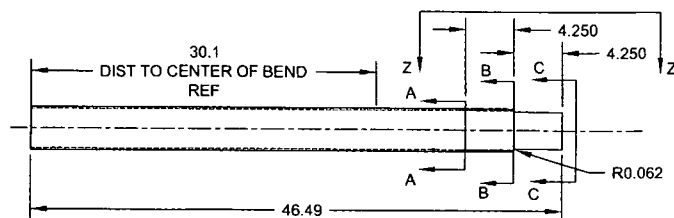


**D3391-1 CUTTING DETAIL**  
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

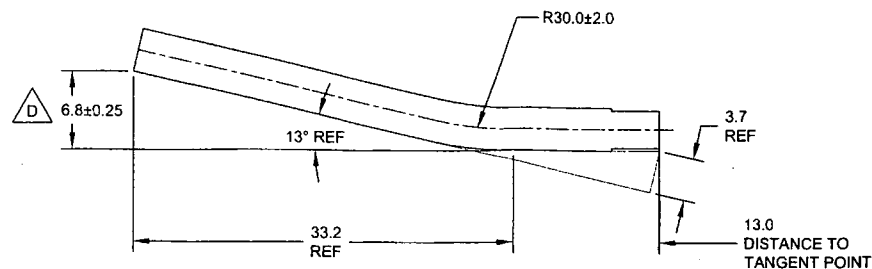


**D3391-011/-021 BENDING DETAIL**  
(MAKE FROM D3391-1)

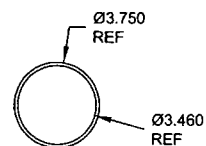


**SECTION A-A**  
SCALE 2X

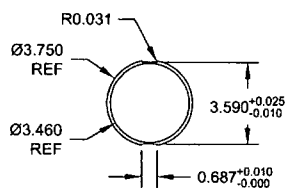

**SECTION B-B**  
SCALE 2X

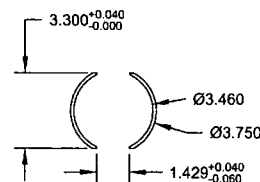



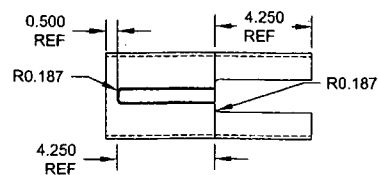

**SECTION C-C**  
SCALE 2X



**VIEW Z-Z**  
SCALE 2X

DEO ATTACHED  
RELEASED  
08.05.10

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. WHO IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Wk 45985

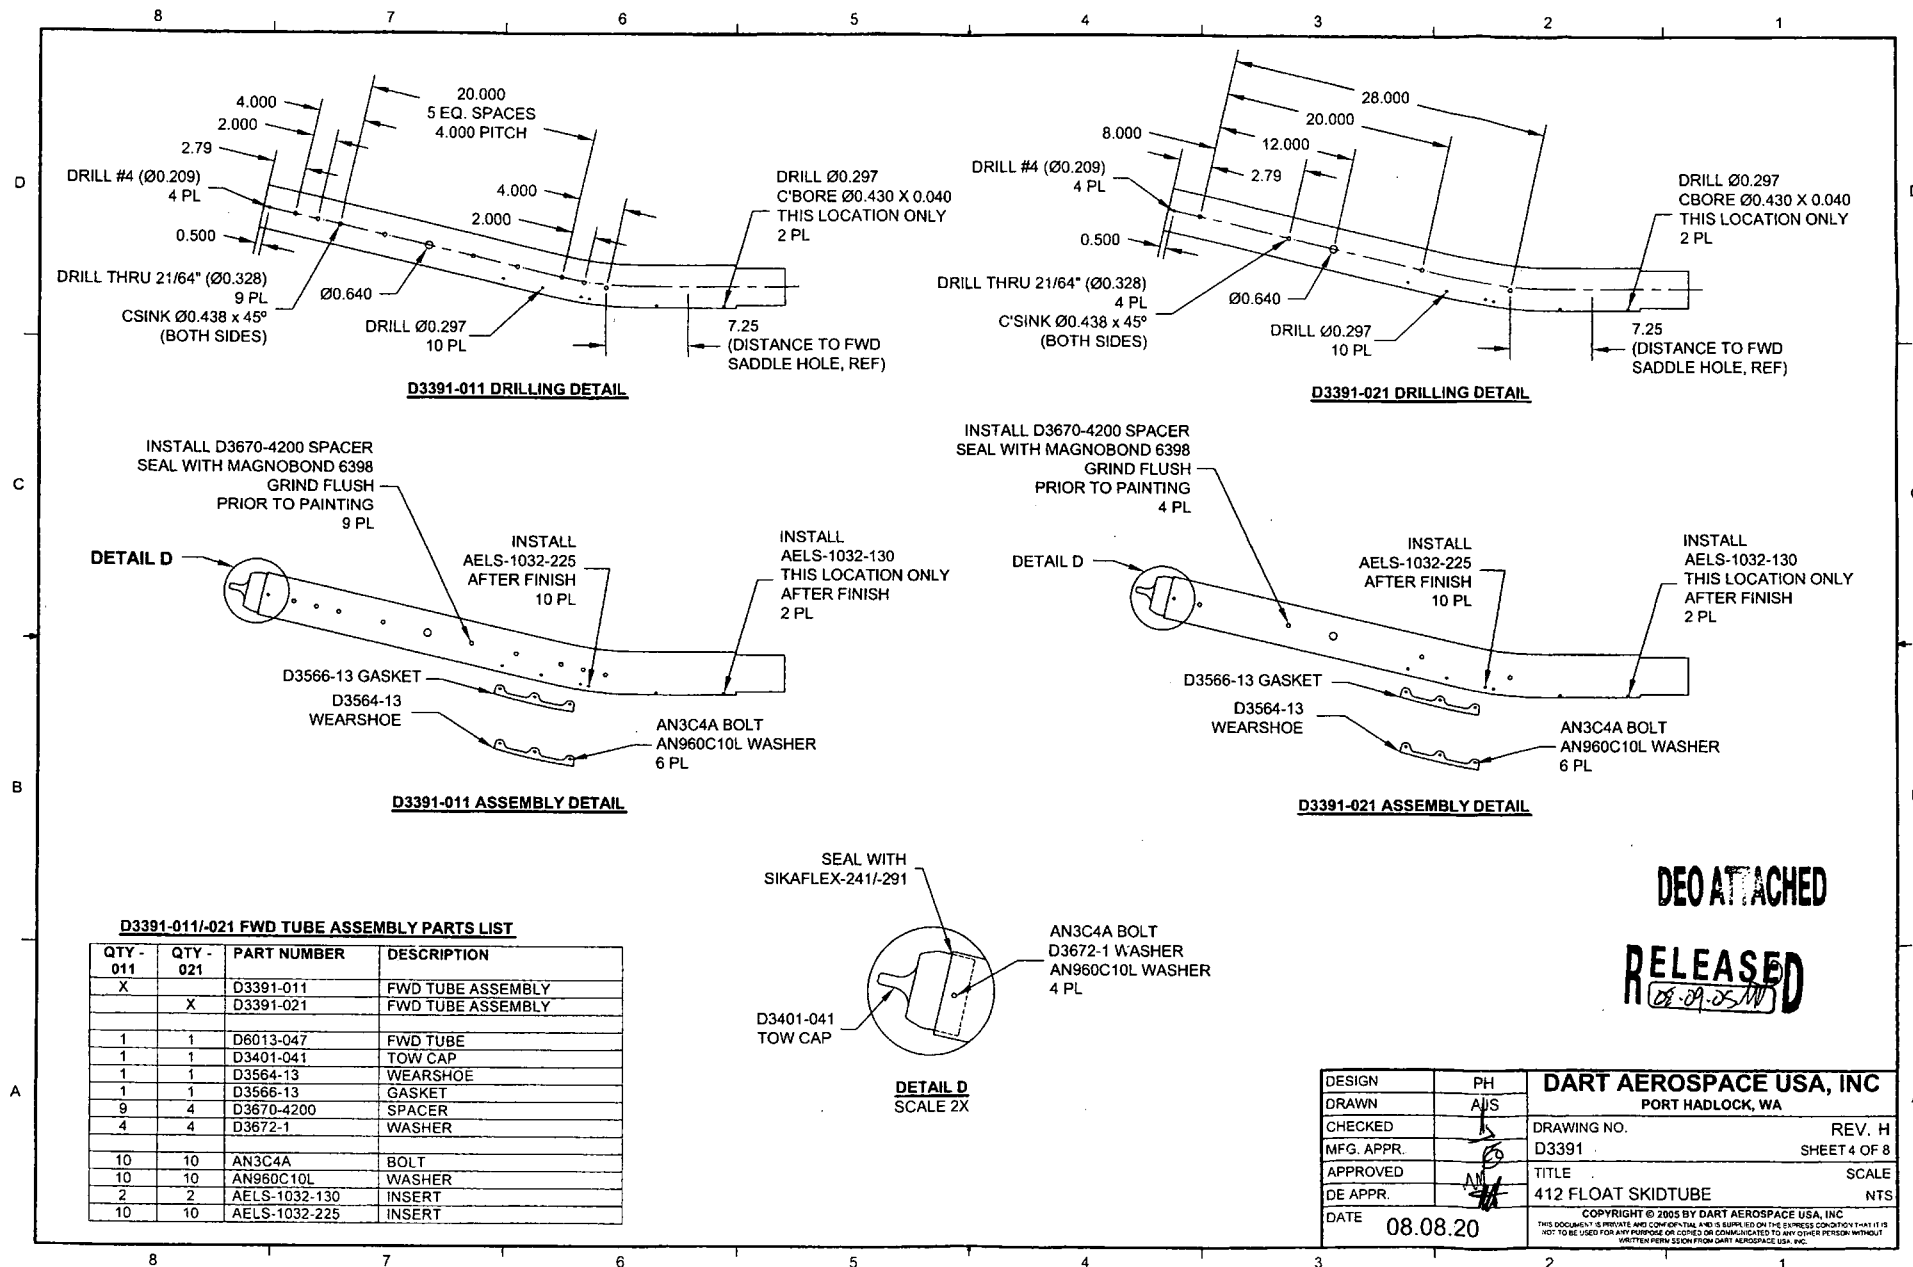

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

u10 65985

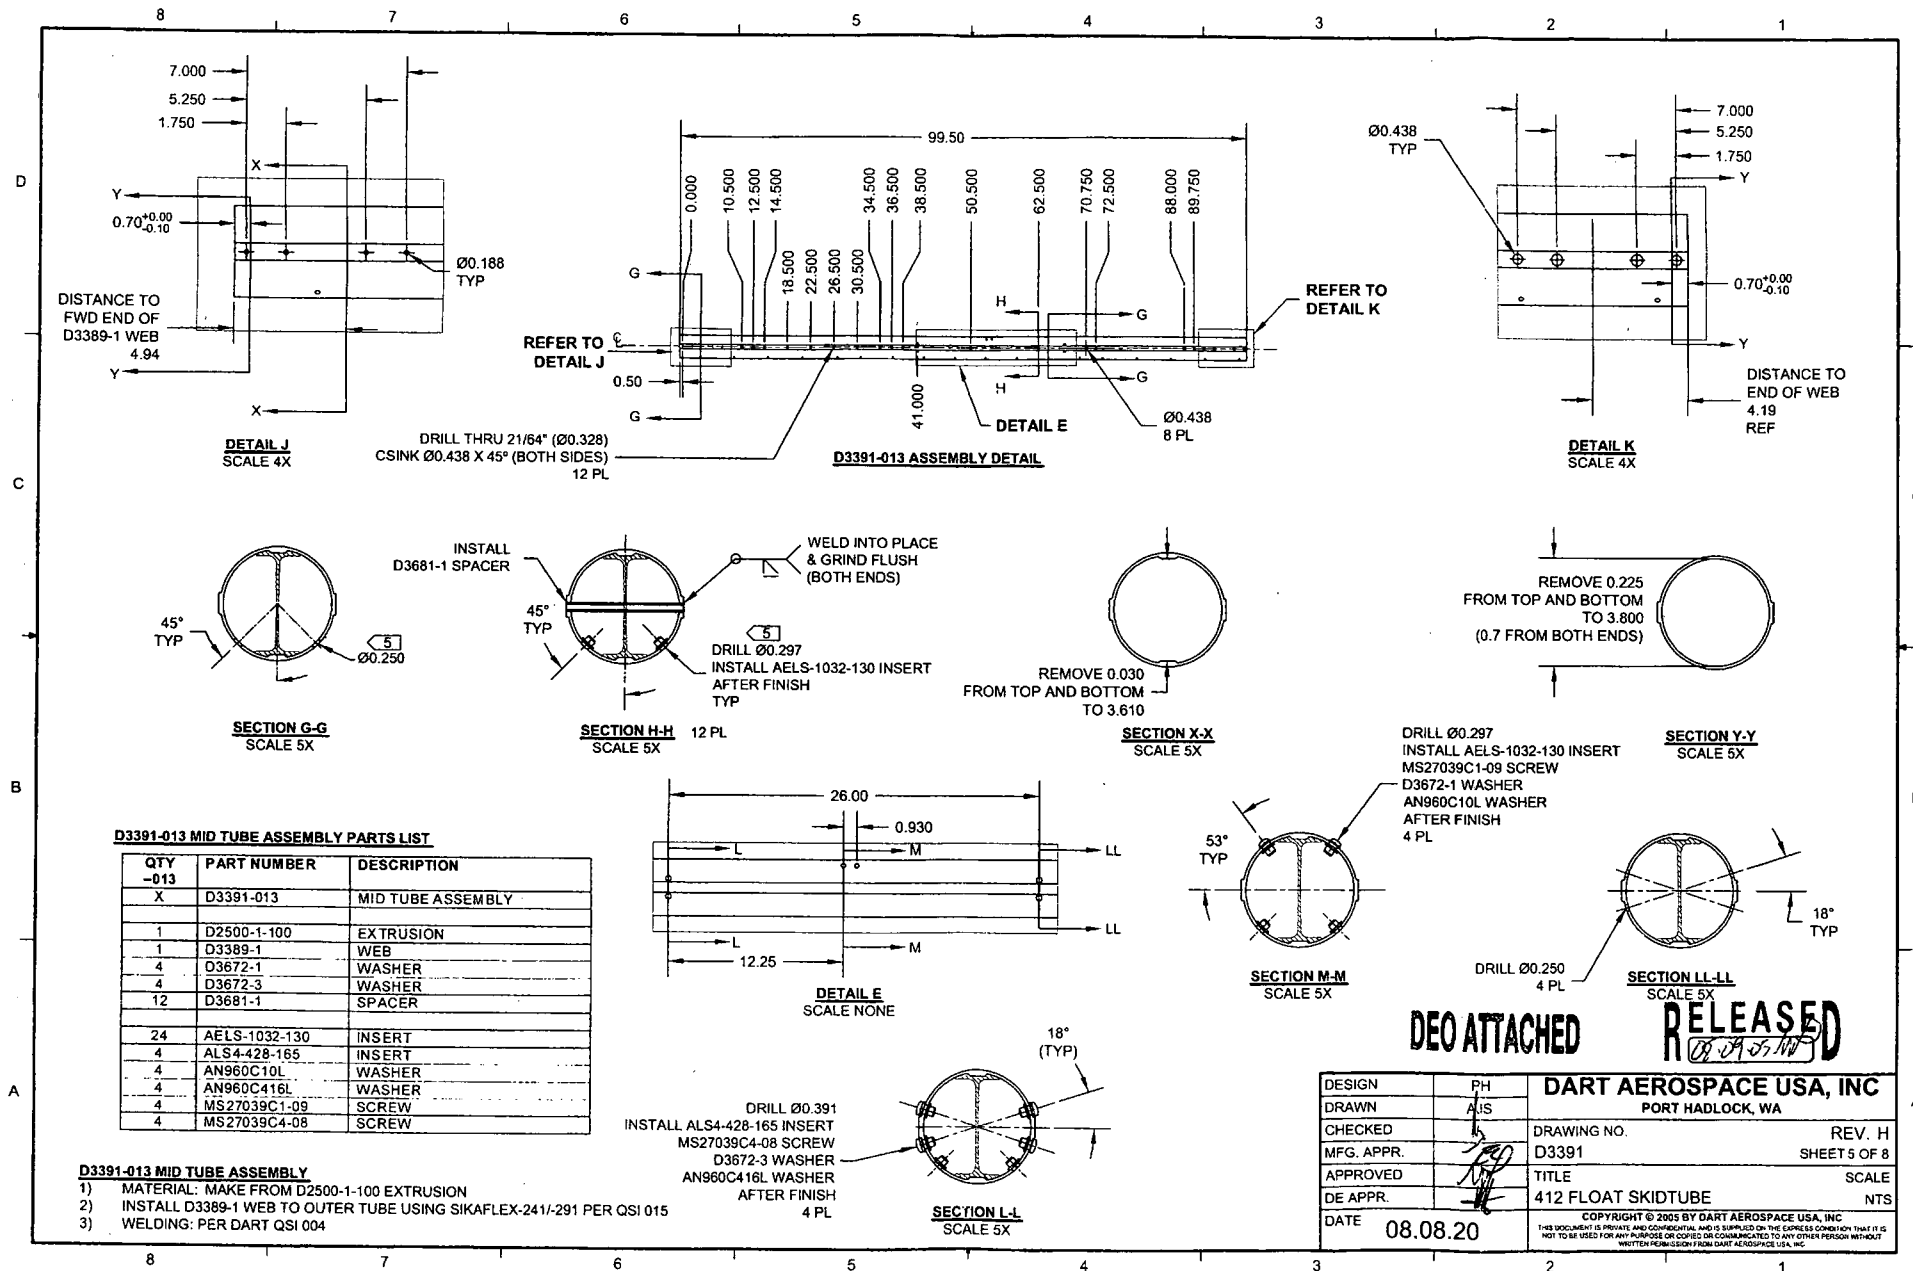

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries


HL 65985

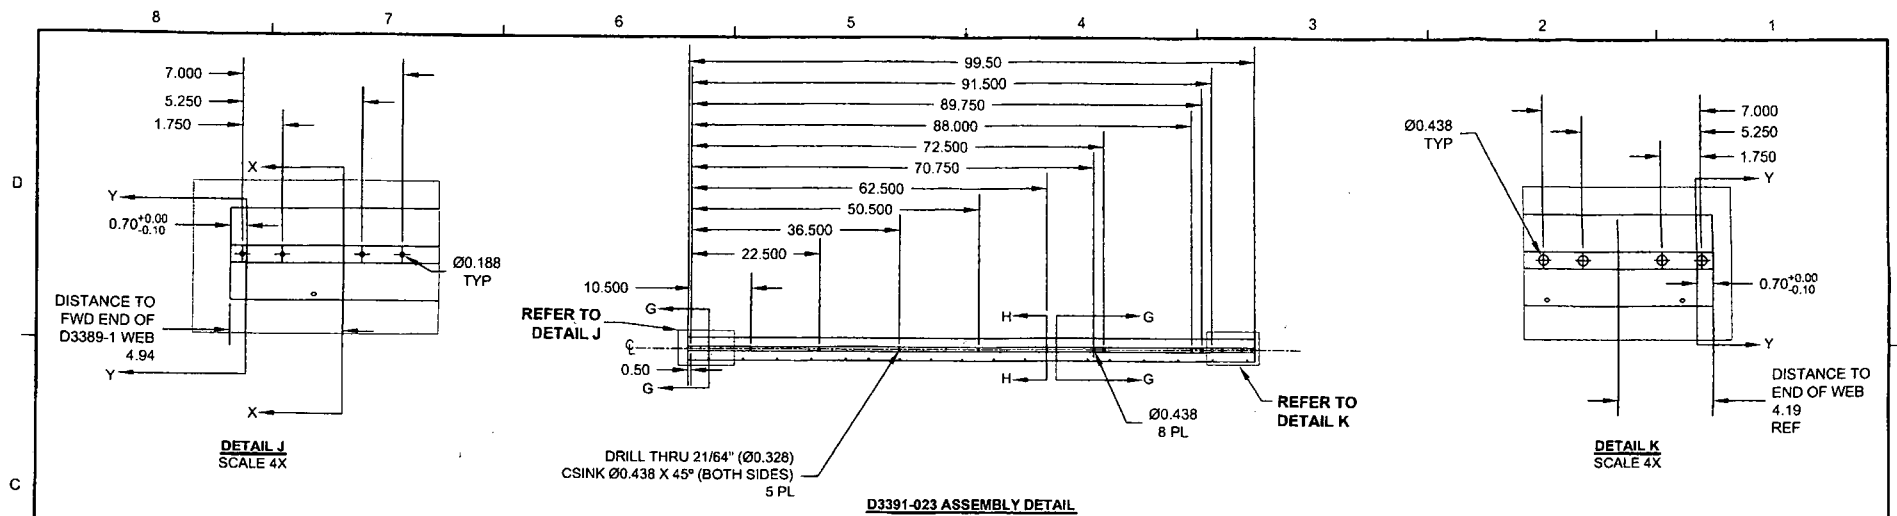


SECTION G-G  
SCALE 5X

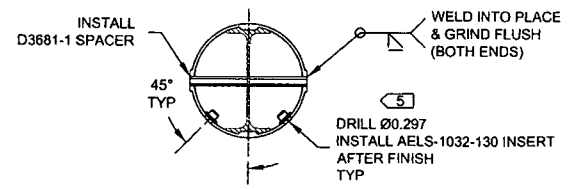

SECTION H-H  
SCALE 5X

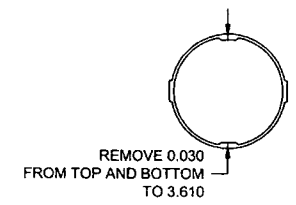

SECTION X-X  
SCALE 5X

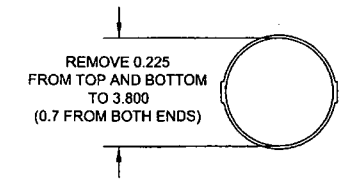

SECTION Y-Y  
SCALE 5X

**D3391-023 MID TUBE ASSEMBLY PARTS LIST**

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

**D3391-023 MID TUBE ASSEMBLY**

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

DEO ATTACHED  
**RELEASED**  
12-01-05-14

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

WLO 65985

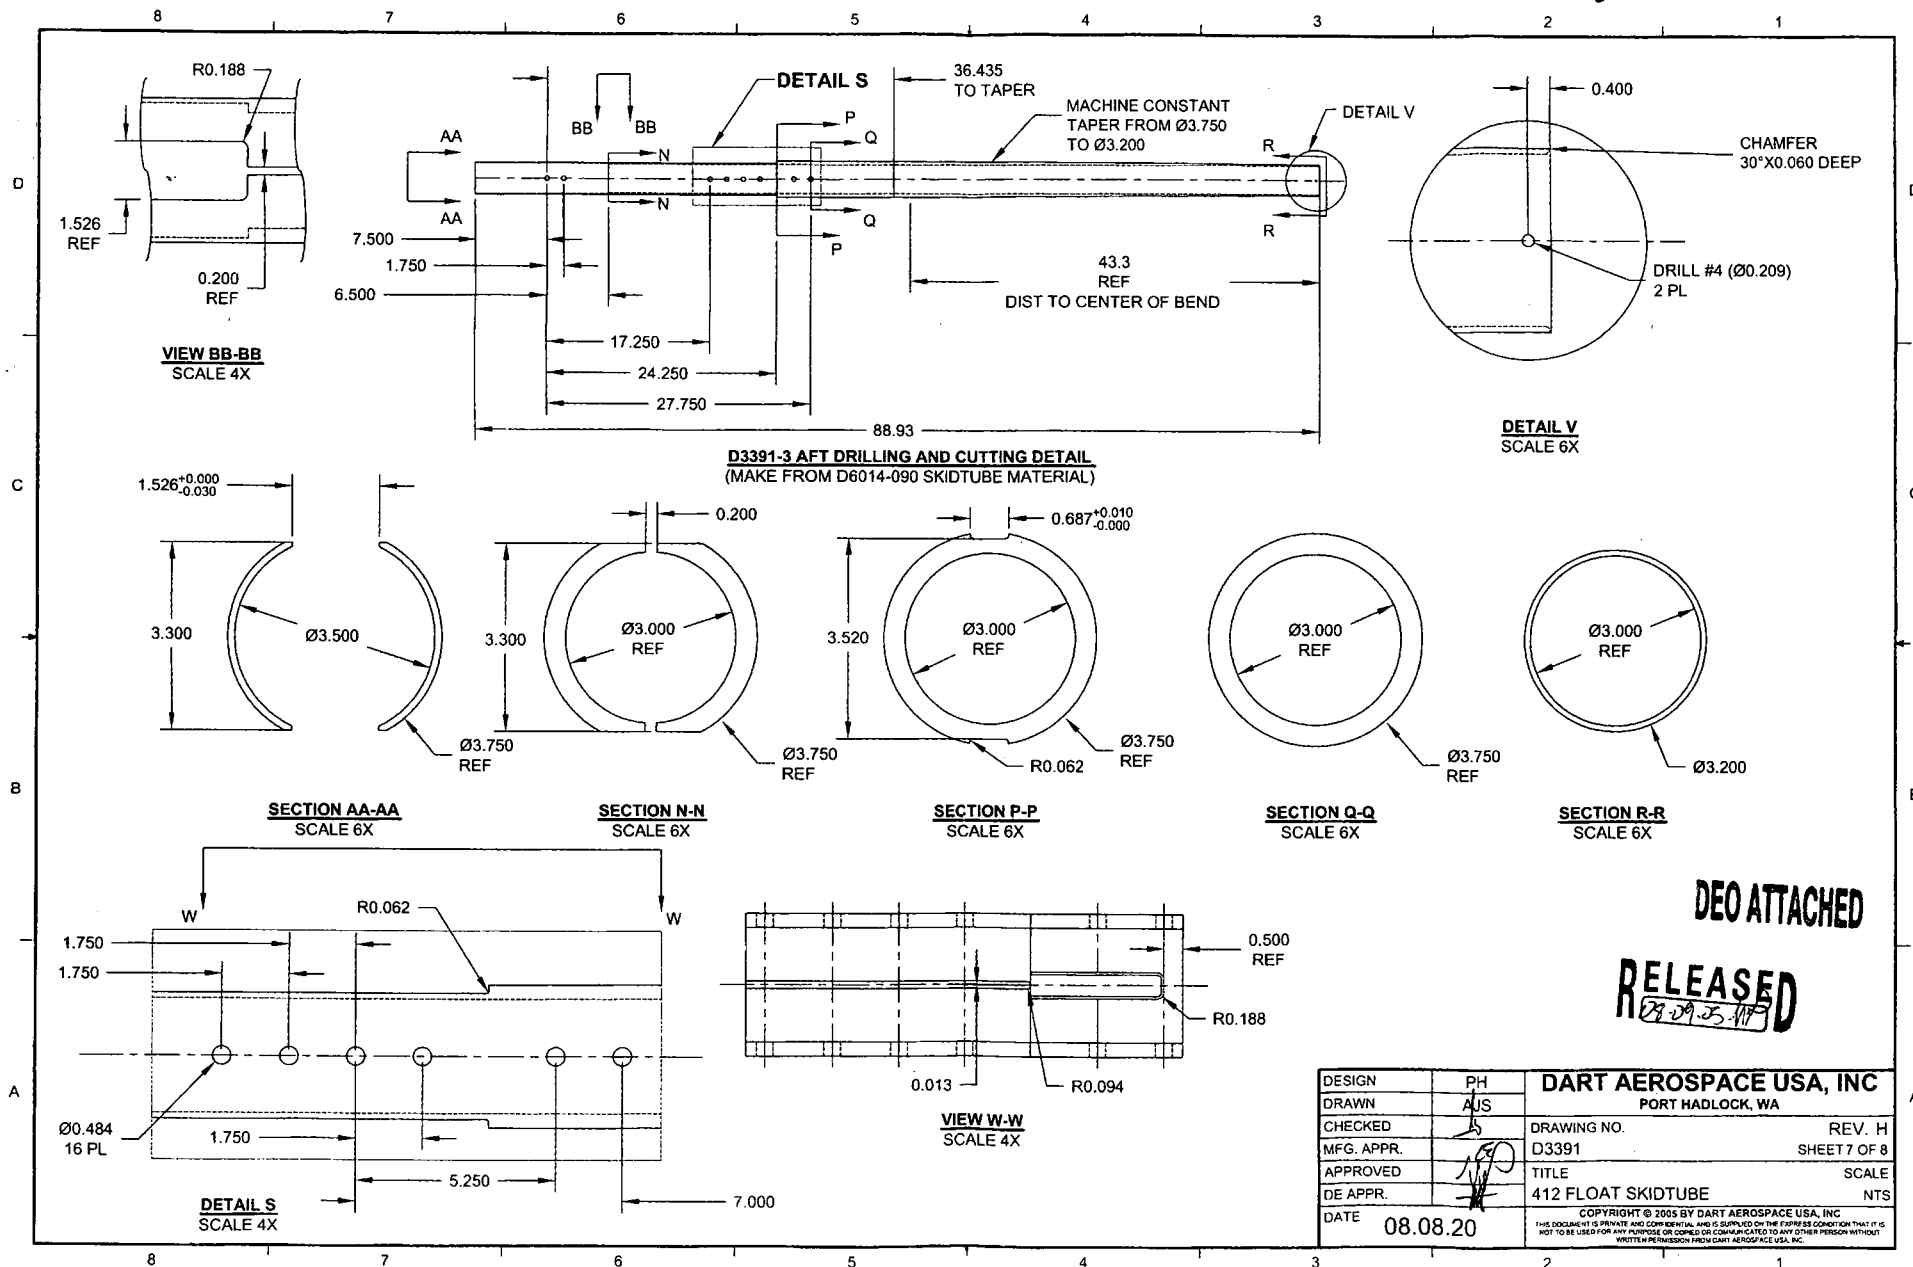

DEO ATTACHED  
RELEASED  
08-09-05-117

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


**NOTE:** Date & initial all entries

21065885

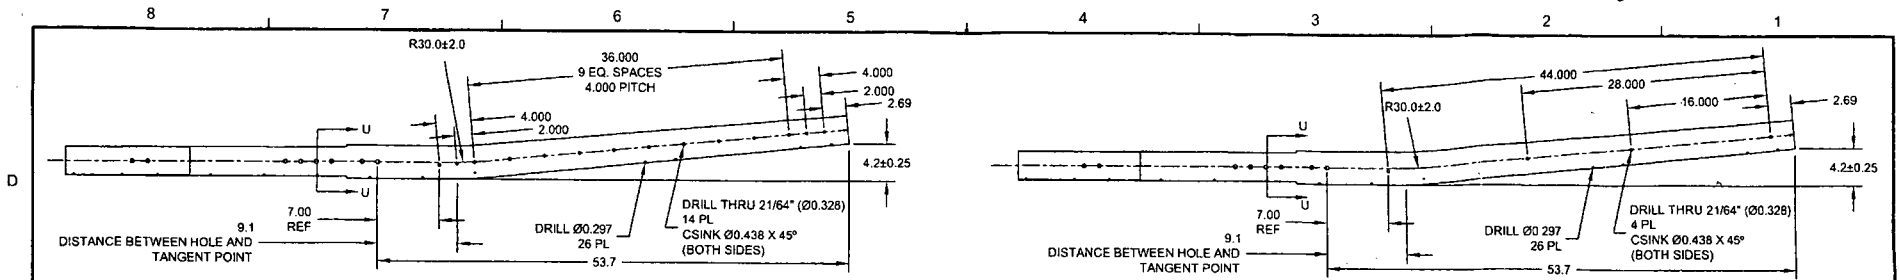

**D3391-015 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

**D3391-025 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)


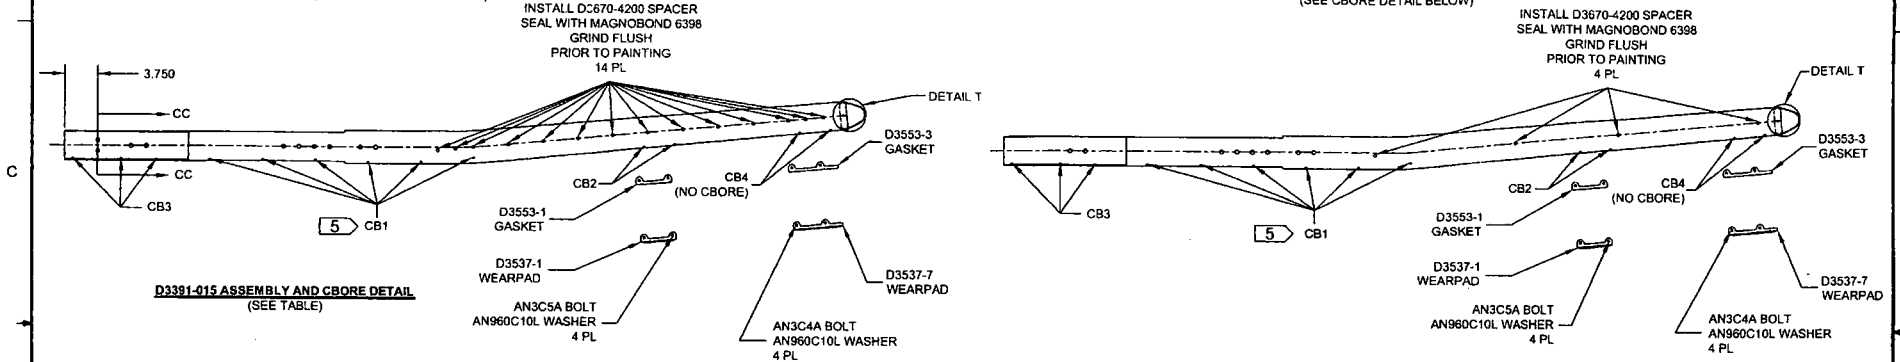


**D3391-015 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)


**D3391-025 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

**D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST**

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-080	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

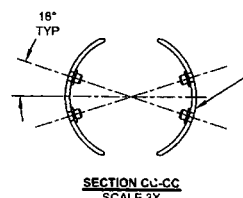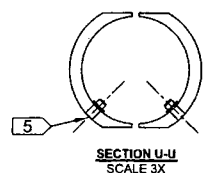

DRILL Ø0.391  
CBORE Ø0.516 X 0.040 DEEP  
INSTALL ALS4-428-165 INSERT  
4 PL

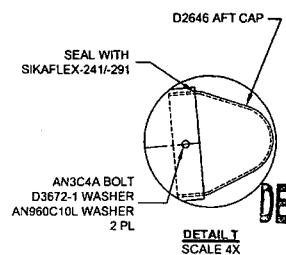

DEO ATTACHED  
**RELEASED**  
08-09-05-141

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND  
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

DRAWING NO. D3391	TITLE 412 FLOAT SKIDTUBE	REV. H	DART AEROSPACE USA, INC ENGINEERING ORDER		D.E.O. NO. D3391-H-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>CP</i>	CHECKED <i>h</i>	MFG. APPR. <i>h</i>	APPROVED <i>h</i>		DE APPR. <i>h</i>		
DATE 09.09.23	DATE 09.09.24	DATE 09/09/25	DATE 09/09/30		DATE 09/09/30		

**PURPOSE:**

LPS-3 IS NO LONGER USED DURING ASSEMBLY OF D3391-041/-043 SKIDTUBES.

**CHANGE:**

AMEND NOTE 2 OF D3391-041/-043 SKIDTUBE ASSEMBLIES (ZN A6-1, A6-2) AS FOLLOWS:

- 2) ~~SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH~~  
~~AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH~~  
 LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS  
 OFF POWDER COATING WITH MEK DEGREASER.

**RELEASED**  
 2010-02-02

*u/w 68985*

COPYRIGHT © 2009 BY DART AEROSPACE USA, INC

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
 NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
 WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

NO. 244

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliott  
Job number: 65328  
Part number: 13391-023  
Description: mid tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Aluminum  
Current: AC[ ] DC[ ]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[ ]  
Penetration: pass[☒] fail[ ]

UNACCEPTABLE

Cracks: pass[☒] fail[ ]  
Undercut: pass[☒] fail[ ]  
Pin holes: pass[☒] fail[ ]  
Overlap (cold lap): pass[☒] fail[ ]  
Porosity (surface): pass[☒] fail[ ]  
Coloration: pass[☒] fail[ ]

Qualifier Pat Adams Date of Test Coupon 11-01-18

Welder Barclay Elliott Date of Test Coupon 11-01-18

The above named individual is qualified in accordance with AWS D17.1.2001 to weld